ANCAP Safety Rating TOYOTA LANDCRUISER 70

(September 2016 - onwards)





Tovota Landcruiser 70

This ANCAP safety rating applies to:		
Make / Model	Model Toyota Landcruiser 70 Series	
Year Range	September 2016 - onwards	
Variant(s)*	Single Cab Chassis variants only	
Vehicle Type	Utility/Van	

The tested model of Toyota Landcruiser 70 single cab chassis was introduced in Australia and New Zealand in October 2016. This ANCAP safety rating applies to single cab chassis variants built from September 2016. Other variants are unrated.


Dual frontal, side head airbags (curtains) and a driver knee airbag are standard. Advanced seat belt reminders are fitted to both front Advanced safety assist technology features such as autonomous emergency braking (AEB) and lane support systems (LSS) are not available. A full list of safety features and technologies can be viewed within the Safety Features & Technologies table on page 2 of this report.

Injury Outcomes.

Frontal Offset

Driver



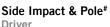



Whiplash Protection

Driver



Head protection only.



GOOD ACCEPTABLE MARGINAL POOR

Test Results Summary.

Airbags	Dual Frontal, Head, Knee
Frontal Offset Test	14.75 (out of 16)
Side Impact Test	16.00 (out of 16)
Pole Test	2.00 (out of 2)
Whiplash Protection	Good
Pedestrian Protection	Marginal
ESC	Standard
Seat Belt Reminders	3.00 (out of 3)
Overall Score	35.75 (out of 37)
ANCAP Safety Rating	****
Rating Year^	2016

Occupant Protection.

Frontal Offset Test

Each body region is scored out of 4 points

Head / neck: 4.00 points Chest: 3.11 points 4.00 points Upper legs: Lower legs: 3.64 points

The passenger compartment held its shape well in the frontal offset test. Pedal and steering wheel displacements were well controlled. Driver and passenger contact with the airbags was stable. All doors remained closed during the crash.

Side Impact Test

Each body region is scored out of 4 points

Head: 4.00 points 4.00 points Chest: Abdomen: 4.00 points Pelvis: 4.00 points

The side impact test normally used by ANCAP simulates a small car striking the driver's door of the test vehicle. Experience shows that large vehicles like this model can be expected to perform well in this test. ANCAP has adopted a policy of awarding these types of vehicles a default score of 16 points (out of 16).

Pole Test

Scored out of 2 points

Score: 2.00 points

The vehicle scored the maximum 2 points for head protection in this

Whiplash Protection Test

Whiplash protection is assessed to the RCAR Protocol

Geometric test: Good Dynamic test: Good Overall whiplash rating: Good

ANCAP Safety Rating TOYOTA LANDCRUISER 70

(September 2016 - onwards)



Pedestrian Protection.

Pedestrian Test

Scored out of 36 points

Adult & child head impacts: 12.17 points Upper leg impacts: 0.00 points 0.00 points Lower leg impacts:

This vehicle scored 12.17 out of 36 points (Marginal). Due to the design of this vehicle, zero points were awarded to regions likely to be struck by pedestrians legs. The central bonnet area offered mixed results for protection to head impacts, while the bonnet outer areas showed poor protection. (v8.2)

Child and adult head impact



Adult leg impact (upper and full legforms)



Score Deductions.

Deductions from frontal offset test scores

Head / neck: No deductions Chest: No deductions No deductions Upper legs: Lower legs: No deductions

Deductions from side impact test score

Head / neck: Default score awarded Chest: Default score awarded Abdomen: Default score awarded Pelvis: Default score awarded

Deductions from pole test score

Head: No deductions

Safety Features & Technologies.

Descriptions of each of these safety features and safety assist technologies (SAT) and detail on fitting requirements for each star rating level can be found at ancap.com.au.

Safety Feature / Safety Assist Technology	Availability
Seat belts (three-point, lap/sash) for all forward-facing seats	s
Seat belt pretensioners (front)	S
Seat belt pretensioners (rear outboard)	N/A
Intelligent seat belt reminder (driver)	S
Intelligent seat belt reminder (front passenger)	S
Intelligent seat belt reminder (2 nd row seats)	N/A
Airbag - Frontal (driver)	S
Airbag - Frontal (passenger)	S
Airbag - Side, chest protection (front seats)	Х
Airbag - Side, chest protection (2 nd row seats)	N/A
Airbag - Side, head protection (front seats)	S
Airbag - Side, head protection (2 nd row seats)	N/A
Airbag - Knee (driver)	S
Airbag - Knee (front passenger)	Х
Head restraints for all seats	S
Adaptive cruise control (ACC)	Х
Antilock braking system (ABS)	S
Autonomous emergency braking (AEB)	Х
- City	X
- Interurban	X
- Vulnerable road user	X
Automatic headlights	X
Automatic high beam	X
Blind spot monitoring (BSM)	X
Electronic brakeforce distribution (EBD)	S
Electronic data recorder (EDR)	S
Electronic stability control (ESC)	S
Emergency brake assist (EBA)	S
Emergency stop signal (ESS)	S
Lane support system (LSS)	X
Daytime running lights (DRL)	X
Hill launch assist	S
Reversing collision avoidance	X
Speed assistance - automatic/intelligent speed limiting (ISA)	X
Speed assistance - manual speed limiting / alarm	X
Speed assistance - speed sign recognition / map	X
Tyre pressure monitoring system (TPMS)	Х

S = Standard on all variants.

O = Optional on base variant. May be standard on higher variants.
V = Not available on base variant but standard or optional on higher variants.

X = Not available on any variant.

E = Available in Europe / USA but not available on any Australasian variant.

These specifications are subject to change. Please check with the manufacturer for the latest specifications

ancap.com.au Page 2 of 3

ANCAP Safety Rating TOYOTA LANDCRUISER 70

(September 2016 - onwards)

Injury Values & Measurements.

Body Region	Frontal offset test at 64 km/h (v5.1)		Side impact test at 50 km/h (v5.1)
	Driver	Passenger	Driver
Head			
HIC	301.90	306.30	
Acceleration (g for 3ms)	44.57	46.33	
Neck			ED
Shear (kN)	0.31	0.46	
Tension (kN)	1.44	1.21	A A A
Extension (Nm)	17.27	19.65	¥ ≷
Chest			VEHICLE E AWARI
Acceleration (g for 3ms)	-	-	SEAT VEHICLE SCORE AWARD
Compression (mm)	28.26	25.71	EAT.
Viscous criterion (m/s)	0.12	0.11	•,
Abdomen			HIGH-SI
Force (kN)	-	-	¥ A
Pelvis			HIGH.
Force (kN)	-	-	Ω
Upper legs			
Femur force left (kN)	1.11	0.32	
Femur force right (kN)	1.07	0.23	
Knee displacement left (mm)	3.38	0.74	
Knee displacement right (mm)	3.11	0.67	
Lower legs			
Force left (kN)	1.74	1.49	
Force right (kN)	1.84	1.79	
Index (upper / lower) left	0.34 / 0.21	0.47 / 0.36	
Index (upper / lower) right	0.26 / 0.20	0.48 / 0.37	
Intrusion Measurements+			
Steering column			
Forward (mm)	38	_	
Upward (mm)	48	_	
Sideways (mm)	31	_	
B 11			

22

18

3

Assessment Details

Pedals

A-Pillar Rearward (mm)

Clutch - rearward (mm) Clutch - upward (mm)

Assessificite Details.	
Tested Make / Model	Toyota LandCruiser 70
Tested Vehicle(s) Built	2016
Tested Body Type	Single Cab Chassis
Tested Vehicle Kerb Weight	2541 kg
Tested Vehicle Engine	4.5 litre V8 diesel
Tested By	ANCAP
Assessed By	ANCAP
Document Reference	LC70_16
Document Created / Revised	19 October 2016
Rating Published	October 2016
Rating Updated	n/a



Frontal offset test at 64km/h

ancap.com.au Page 3 of 3

⁺ Steering column and pedal movements are measured relative to the driver's seat.

^{*} Model Variants: ANCAP safety ratings do not automatically extend to variants that have different body styles, engine configurations, driven wheels or occupant restraint systems (e.g. fewer airbags). In these cases, ANCAP considers technical evidence submitted by manufacturers before deciding on extending a rating to additional variants of a model. For further information about the application of ANCAP safety ratings to model variants, see the ANCAP Variant Policy.

[^] Rating Year: The Rating Year denotes the year requirements against which a vehicle has heart the Rating rear deflotes the year requirements against which a vehicle massessed. The Rating Year is determined by ANCAP and may be based on the year in which a new vehicle model is first launched into the Australian and/or New Zealand markets; the year in which the vehicle was tested (if tested by Euro NCAP); or, for vehicles which hold an existing ANCAP safety rating, the year in which the rating was updated (or earlier applicable year)